



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

Ship Alone
M27 12

D3391-023
Job Sheet 175481



Part No: D3391-023

Job Qty: 1 ea

Part Name: Mid Tube Assembly



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 4/5/18

Job Tracking No:

Due Date: 5/4/18

Created By: Marie Lajeunesse

Type: SOLD

Description:

Note: DWG-REV J SHEET 7 IPP A 05.10.20 New Issue KJ/EC IPP B IPP C 07.03.20 rev F dwg EC IPP D 07.03.28 re-format EC IPP E 07.10.31 ecn 1053P EC IPP Rev:F ECN 1056 07-11-13 DD verified by: EC IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC IPP Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP Rev:J add in seq 140 expire date &b# sikaflex DD 10.02.17 verified by:EC

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		5/3/18	0.00	0.00	Start Up Skidtubes-1		<i>M27</i>
100	Skidtubes	1 pcs		5/3/18	0.88	2.11	Skidtubes-4		<i>M27</i>
110	QC	1 pcs		5/3/18	0.00	0.00	QC5		<i>ECB</i>
120	HandFinish	1 pcs		5/3/18	0.00	0.38	HandFinish1		<i>BE 8-04-17</i>
130	QC	1 pcs		5/3/18	0.00	0.00	QC7-2		<i>BE</i>
140	Skidtubes	1 pcs		5/3/18	0.00	2.11	Skidtubes-4		<i>M27</i>
150	QC	1 pcs		5/3/18	0.00	0.00	QC5		<i>BE</i>
160	Skidtubes	1 pcs		5/3/18	0.00	2.11	Skidtubes-4		<i>DAS</i>
170	QC	1 pcs		5/3/18	0.00	0.00	QC10		<i>38 DAS</i>
180	QC	1 pcs		5/3/18	0.00	0.00	QC5		<i>9-80 38</i>
185	HandFinish	1 pcs		5/3/18	0.00	0.38	HandFinish2		<i>SA 18-04-24</i>
191	SprayPaint	1 pcs		5/3/18	0.00	0.91	Spray Paint		<i>NLA</i>
192	Outsource	1 pcs	<i>39813</i>	5/3/18	<i>39770</i>	<i>21805107</i>	ATE003-VC	<i>39704</i>	<i>C21 8/04/25</i>
193	Packaging	1 pcs		5/3/18	0.00	0.00	Packaging2		<i>AT 8/04/26</i>
200	QC	1 pcs		5/3/18	0.00	0.00	QC14		<i>SA 18-04-17</i>
230	HandFinish	1 pcs		5/4/18	0.00	0.38	HandFinish4		<i>M27</i>
240	QC	1 pcs		5/4/18	0.00	0.00	QC5		<i>38</i>
250	Packaging	1 pcs		5/4/18	0.00	0.00	Packaging3-1		<i>9-80 Smb</i>
260	QC21-SA	1 Ea		5/4/18	0.00	0.00	QC21		<i>21 MAY 1 1 2018</i>

Part Op 100 - 1-Cut tube to finish length as per Dwg D3391 2-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1
Descriptions: fwd saddle hole on one side only as per Dwg D3391 3-Open aft saddles and GHW holes to Ø0.4375" except for fwd saddle
holes 4-Remove .030" from Fwd indexing Ridge as per Dwg D3391 5-Remove indexing ridge on Fwd & Aft end of
skidtube as per Dwg D3391 6-Deburr, scribe batch # on aft end. 7-Locate D3391-021 in D3391-023 at 9.00" (see view,
F-E) 8- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149
locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect alignment, open up previously transfer
drilled pilot holes in D3391-023/-021 using drill press. ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to
0.500" as per ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499". D3391-021
BATCH: 9- Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.375" holes with paint marker,
DO NOT DRILL HOLES #3-19-20 FROM FWD END OF JIG Locating from two fwd wearplate holes in D3391-023
drill remaining 6 wearplate holes in D3391-021 using DT8937 10- Open wearplate holes of D3391-023 assembly detail
section Q-Q to Ø0.375" (10 holes) as per Dwg D3391 Open wearplate holes of D3391-023 assembly detail section H-H to
Ø0.297" (20 holes) as per Dwg D3391 Deburr and blow out all chips from inside tube, scribe

5059533

Ar 18/04/26

fg 039

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

140 - 1-Open float bag holes as per dwg 2-C'sink float bag holes as per dwg 3- Prepare tube for welding 4-Bond web in place as per Dwg D3391 & QSI 015. Adhere for 12 hours) A/R Sikaflex exp: 18-04-21 batch#: M138659
 NOTE:ENSURE WEB IS INSERTED IN AFT END OF TUBE
 160 - 1-Weld crossbolt spacer as per dwg D3391 & QSI 004 2-grind weld flush A/R M 038611
 185 - Re-alodine
 191 - PRIME AS PER DWG AND QSI005 4.2.1.3.3 PRIMER BATCH: _____ PAINT AS PER DWG AND QSI005 4.2.2.4 PAINT: _____
 230 - 1-Install Inserts as per Dwg

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D2500-1-100	Skidtube Extrusion	1 Ea (1 ea)	90-Start up Operation	<u>BK3253</u>
D3389-1	Web	1 Ea (1 ea)	140-Skidtubes	<u>S659800</u>
D3681-1	Spacer	5 Ea (5 ea)	160-Skidtubes	<u>5019147</u>
ALS4-1032-130	Rivnut	20 Ea (20 ea)	230-HandFinish	<u>5008959</u>
D3591-1	Bushing	2 Ea (2 ea)	230-HandFinish	<u>5026944</u>
				<u>003070</u>

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D2500-1-100	1	62	0
140-Skidtubes	D3389-1	1	1	0
160-Skidtubes	D3681-1	5	248	0
230-HandFinish	ALS4-1032-130	20	14,829	0
	D3591-1	2	55	0

Part Specifications

Specifications could not be found.

Plex 4/5/18 10:22 AM Dart.lajeunesse.marie

Dart Aerospace Ltd.
 1270 Aberdeen Street
 Hamilton, ON K8A 1K7
 TEL: 1 813 632-5200
 Email: sales@dartaero.com
 www.dartaero.com



Container No: S059533



Part: D3391 - 023

Job No: 175481

Serial No/Batch: S059533

Revision: J
 Inspector:

Date: 04/10/18

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

D3391-041/-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY -041	QTY -043	PART NUMBER	DESCRIPTION
X	X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
	X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1		D3391-011	FWD TUBE ASSEMBLY
1		D3391-013	MID TUBE ASSEMBLY
1		D3391-015	AFT TUBE ASSEMBLY
	1	D3391-021	FWD TUBE ASSEMBLY
	1	D3391-023	MID TUBE ASSEMBLY
	1	D3391-025	AFT TUBE ASSEMBLY
2	2	D3591-1	BUSHING
4		D3672-3	WASHER
1	1	D4095-041	WEARSHOE
1	1	D4095-043	WEARSHOE
1	1	D4095-045	WEARSHOE
1	1	D4095-047	WEARPAD
1	1	D4095-049	WEARPAD
1	1	D4095-051	WEARSHOE
24	24	AN3C4A	BOLT
4	4	AN3C6A	BOLT
10	10	AN5C7A	BOLT
28	28	NAS1149C0332R	WASHER
10	10	NAS1149C0532R	WASHER
4		MS27039C4-12	SCREW
4		NAS1149C0432R	WASHER



SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 175481 *MLJ*
18-04-05

J	INCORPORATED DSI 9733, REFORMAT DRAWING CHANGED CBORE DEPTH (ZN D2-8, D2-9), REVISED TABLES, REPLACED POWDER COAT WITH PAINT	ML	16.01.14
I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A8-4, ZN B8-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C8 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C8 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9384 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	<i>[Signature]</i>	D3391	SHEET 1 OF 11
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2016-04-28
ECN 16-516 *CM*

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

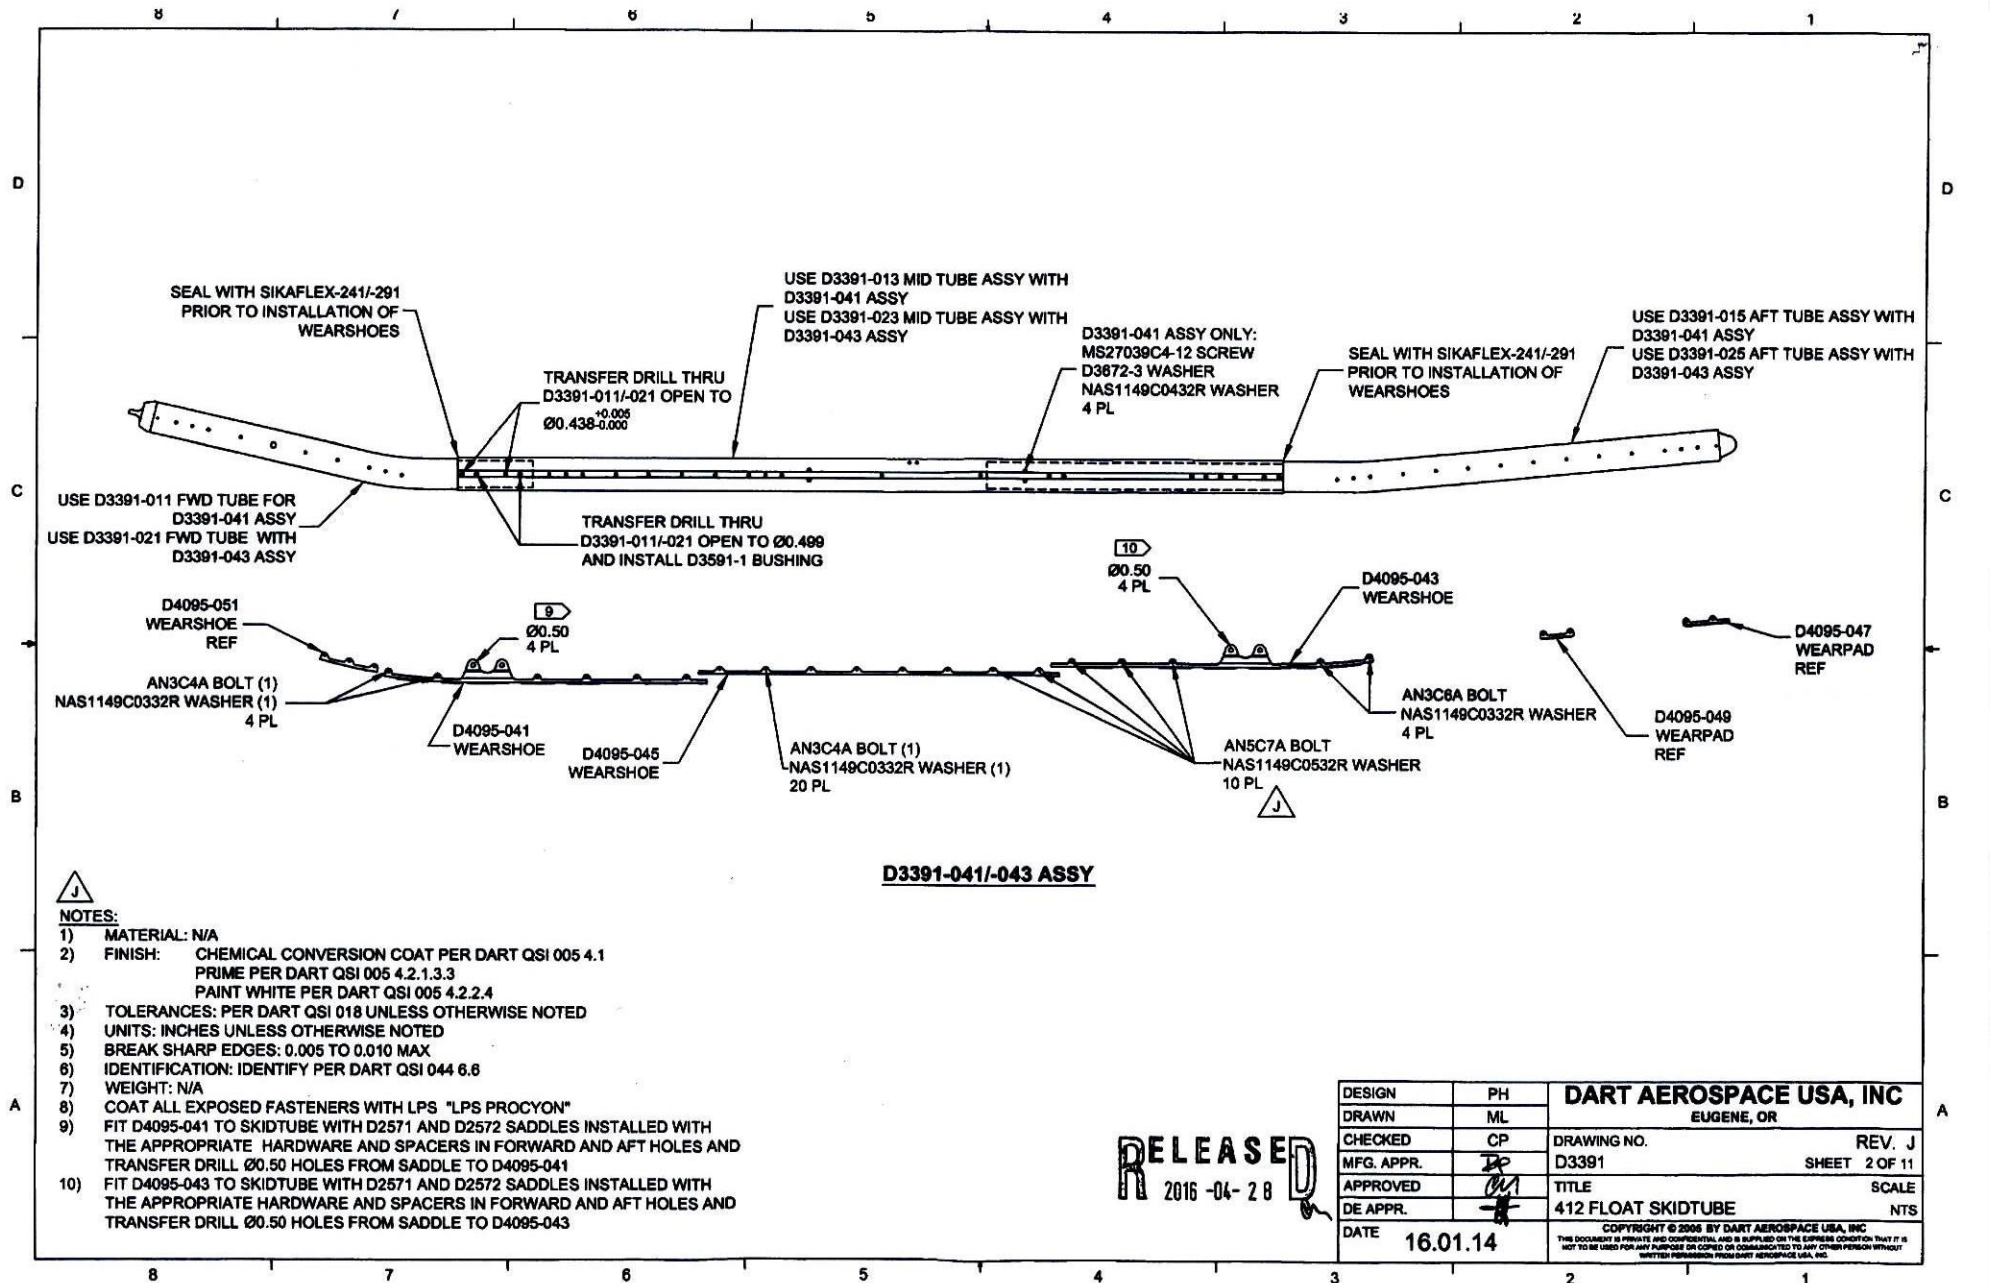

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

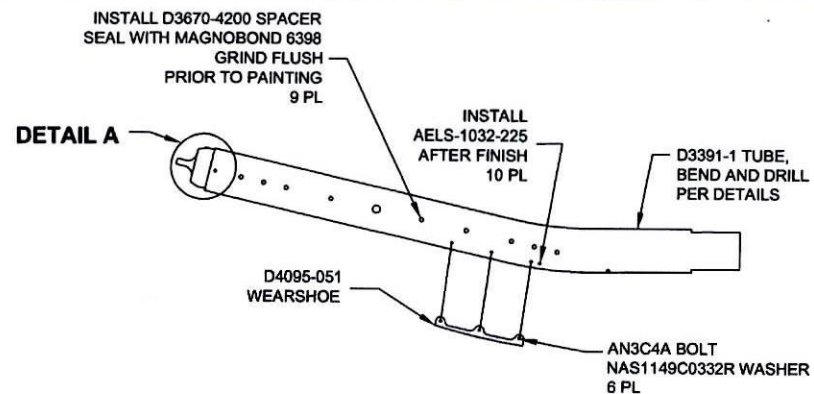


D3391-011 FWD TUBE ASSEMBLY
ASSEMBLY DETAIL

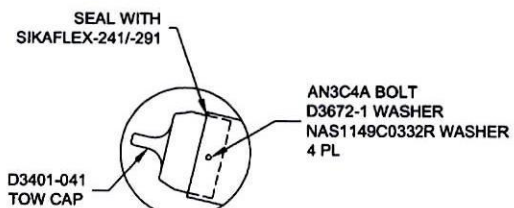


DETAIL A
SCALE 2X

D3391-011 FWD TUBE ASSEMBLY PARTS LIST

QTY -011	PART NUMBER	DESCRIPTION
X	D3391-011	FWD TUBE ASSEMBLY
1	D3391-1	TUBE
1	D3401-041	TOW CAP
9	D3670-4200	SPACER
4	D3672-1	WASHER
1	D4095-051	WEARSHOE
10	AELS-1032-225	INSERT
10	AN3C4A	BOLT
10	NAS1149C0332R	WASHER

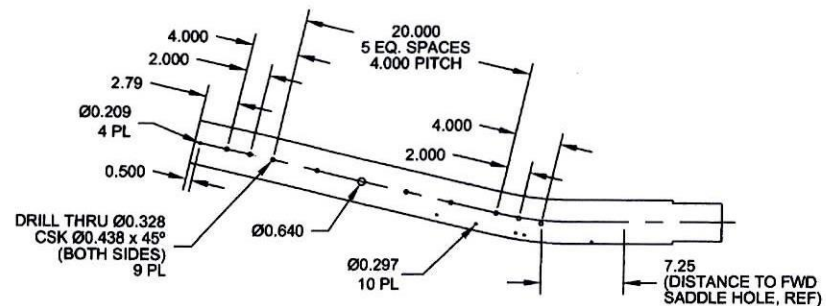

D3391-011 DRILLING DETAIL

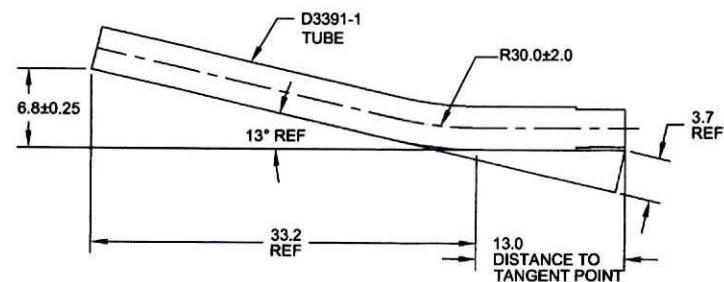

D3391-011 BENDING DETAIL
(MAKE FROM D3391-1)

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 3 OF 11
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
4 PL

DETAIL B

D4095-051
WEARSHOE

INSTALL
AELS-1032-225
AFTER FINISH
10 PL

AN3C4A BOLT
NAS1149C0332R WASHER
6 PL

D3391-021 FWD TUBE ASSEMBLY ASSEMBLY DETAIL

SEAL WITH
SIKAFLEX-241/-291


D3401-041
TOW CAP

AN3C4A BOLT
D3672-1 WASHER
NAS1149C0332R WASHER
4 PL


DETAIL B SCALE 2X

D3391-021 FWD TUBE ASSEMBLY PARTS LIST

QTY -021	PART NUMBER	DESCRIPTION
X	D3391-021	FWD TUBE ASSEMBLY
1	D3391-1	TUBE
1	D3401-041	TOW CAP
4	D3670-4200	SPACER
4	D3672-1	WASHER
1	D4095-051	WEARSHOE
10	AELS-1032-225	INSERT
10	AN3C4A	BOLT
10	NAS1149C0332R	WASHER

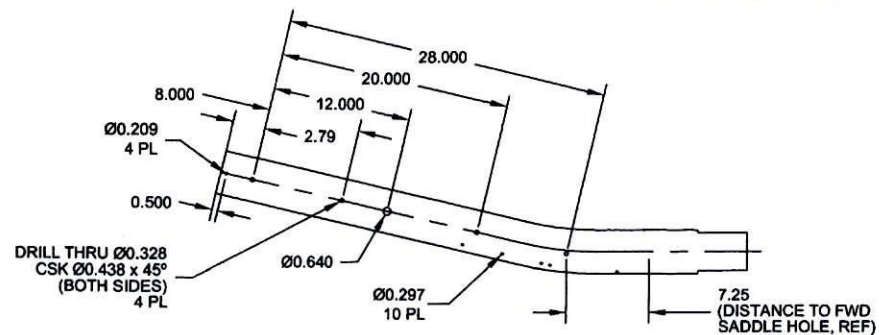

D3391-021 DRILLING DETAIL

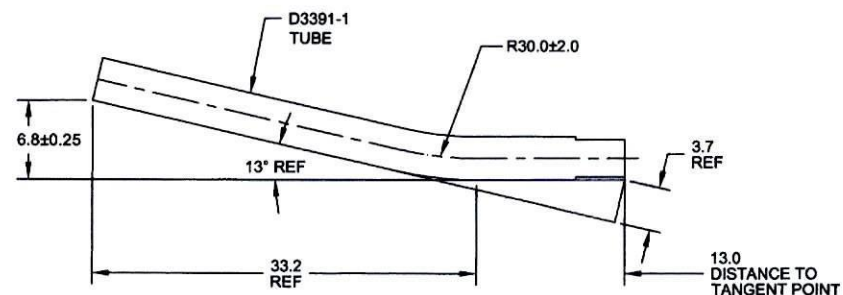

D3391-021 BENDING DETAIL (MAKE FROM D3391-1)

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	TS	D3391	SHEET 4 OF 11
APPROVED	CP	TITLE	SCALE
DE APPR.	TS	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

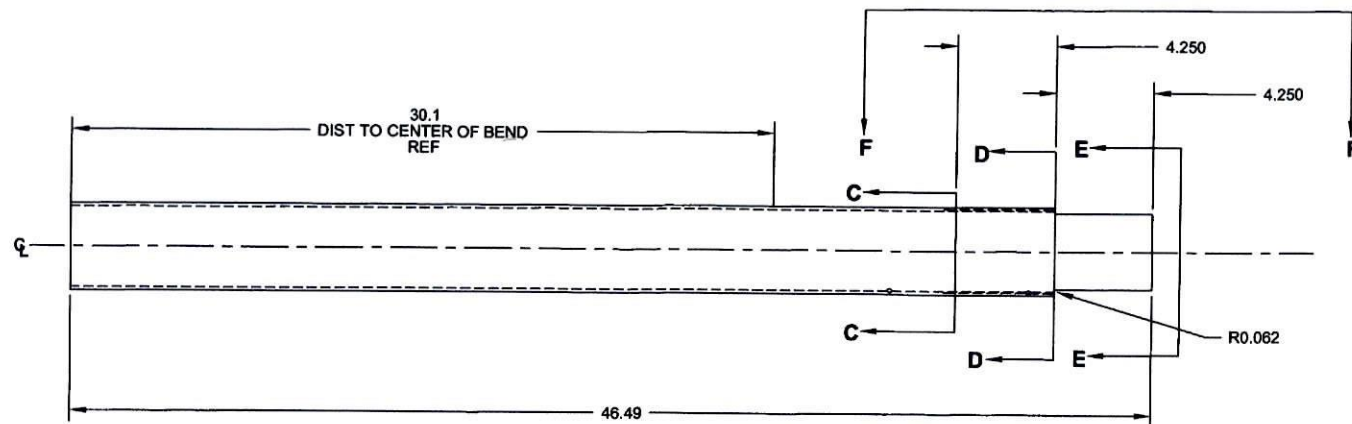


D3391-1 TUBE
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

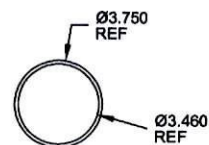


SECTION C-C

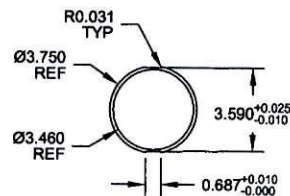

SECTION D-D

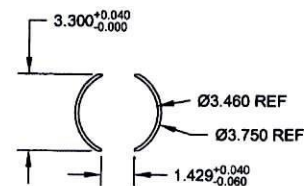

SECTION E-E

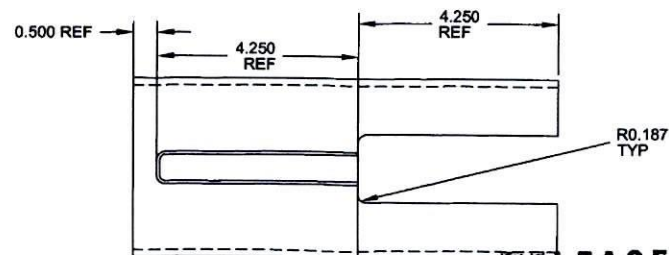

VIEW F-F
SCALE 2X

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	22	D3391	SHEET 5 OF 11
APPROVED	Ch	TITLE	SCALE
DE APPR.	#	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

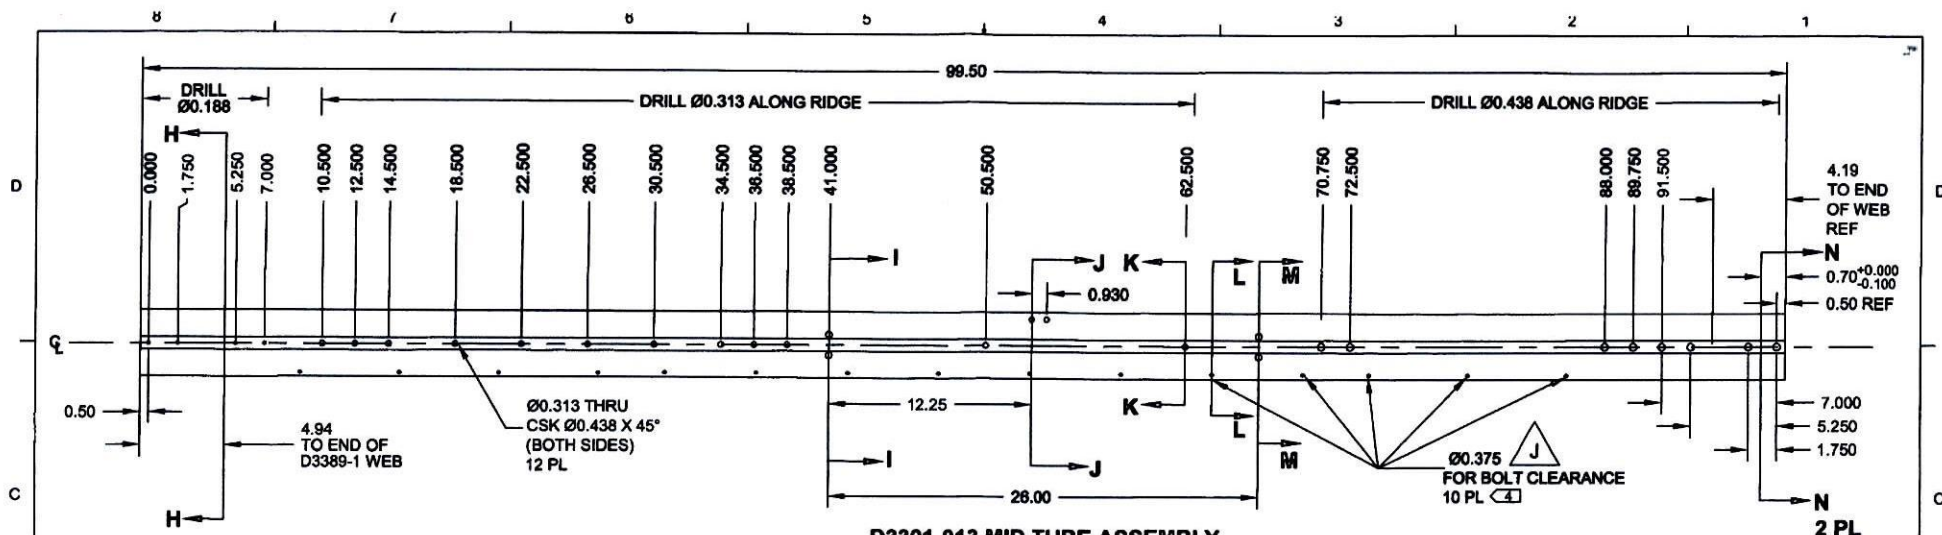

D3391-013 MID TUBE ASSEMBLY

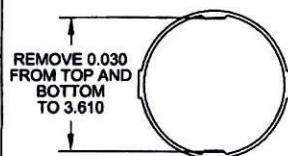


SECTION H-H
SCALE 2X

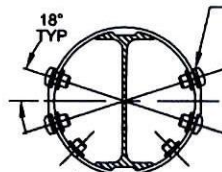


SECTION I-I
SCALE 2X

DRILL Ø0.391
INSTALL ALS4-428-165 INSERT
MS27039C4-08 SCREW
D3672-3 WASHER
NAS1149C0432R WASHER
AFTER FINISH
4 PL

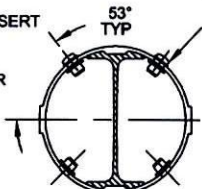


SECTION J-J
SCALE 2X

DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
NAS1149C0332R WASHER
AFTER FINISH
4 PL

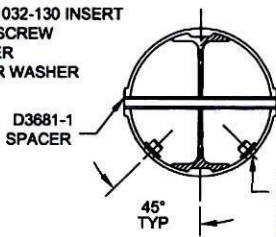

SECTION K-K
SCALE 2X


WELD INTO PLACE
& GRIND FLUSH
(BOTH ENDS)
12 PL

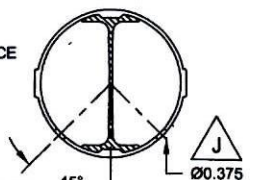


SECTION L-L
SCALE 2X

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY -013	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW
4	NAS1149C0332R	WASHER
4	NAS1149C0432R	WASHER

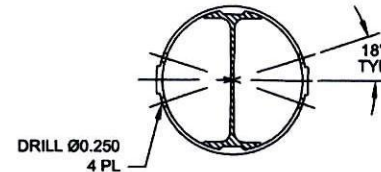

SECTION M-M
SCALE 2X

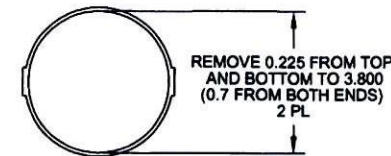

SECTION N-N
SCALE 2X



D3391-013 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004
- 4) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. CBORE AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED.

DESIGN	PH
DRAWN	ML
CHECKED	CP
MFG. APPR.	PA
APPROVED	PA
DE APPR.	PA
DATE	16.01.14

DART AEROSPACE USA, INC EUGENE, OR	
DRAWING NO. D3391	REV. J SHEET 6 OF 11
TITLE 412 FLOAT SKIDTUBE	SCALE NTS
COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2016-04-28

DQA: _____ Date: _____








WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

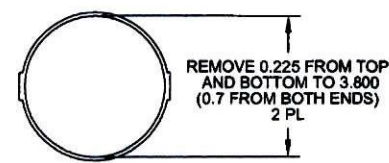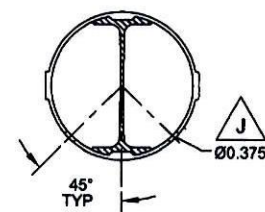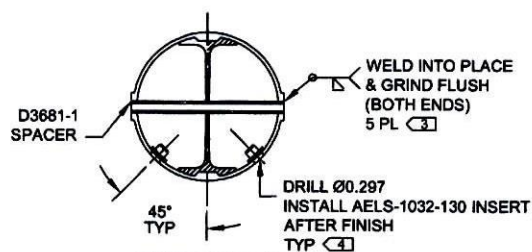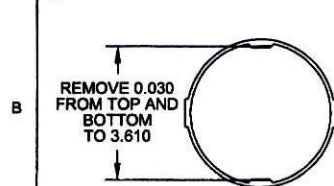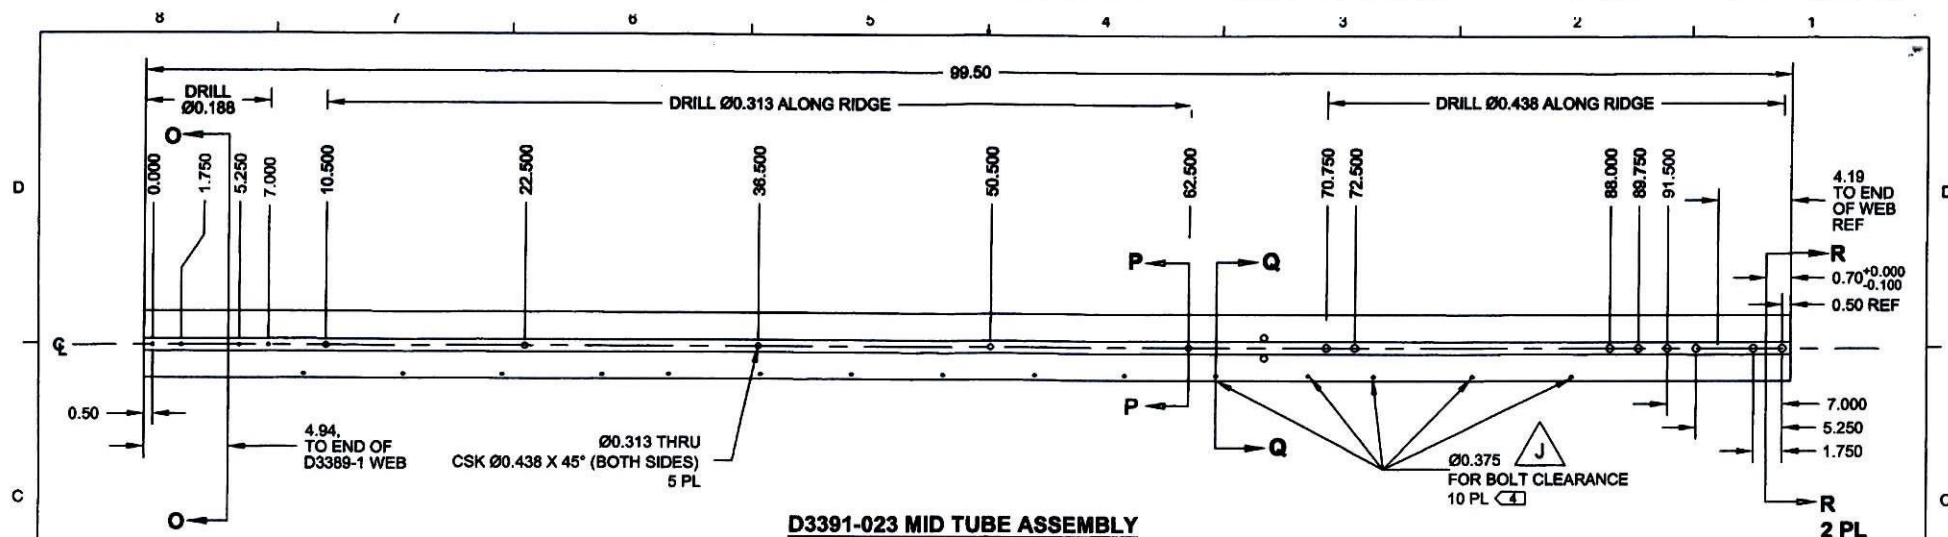

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT



D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-281 PER QSI 015
- 3) WELDING: PER DART QSI 004
- 4) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. CBORE AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED.

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 7 OF 11
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2016-04-28

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

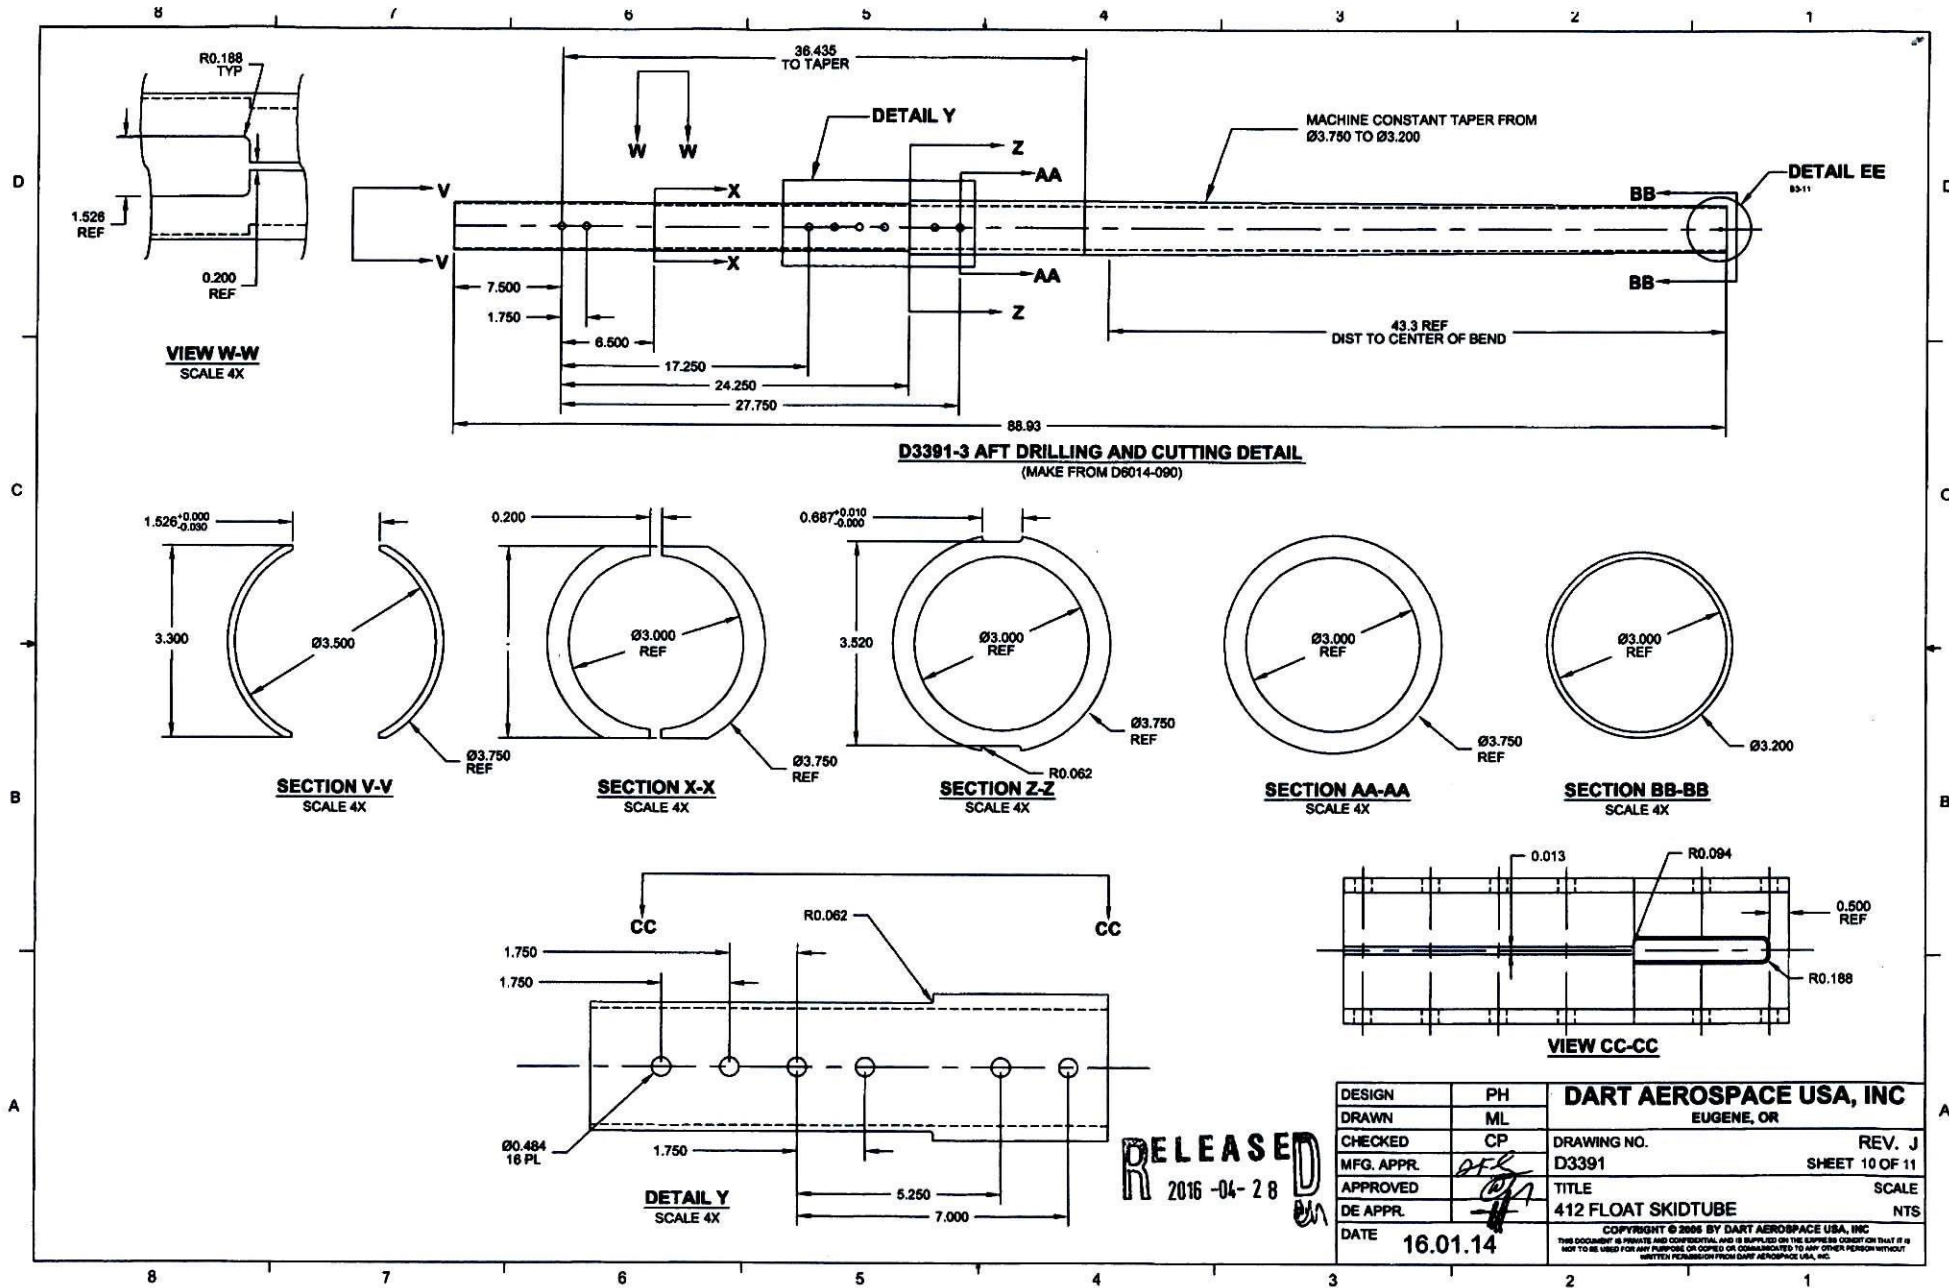

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	<i>[Signature]</i>	D3391	SHEET 10 OF 11
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS COVENANT THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

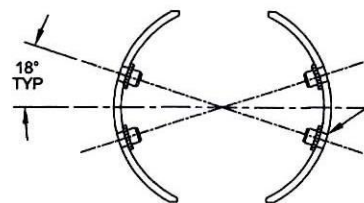


SECTION S-S
SCALE 5X

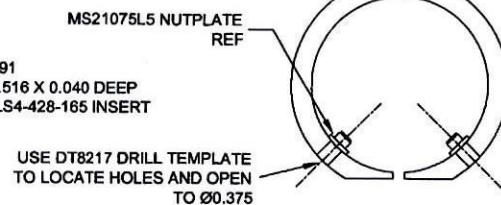


SECTION T-T
SCALE 5X
5 PL

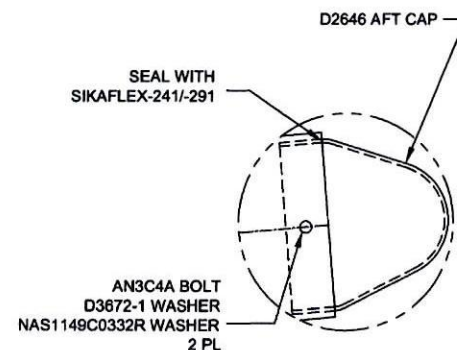

DETAIL U
SCALE 5X

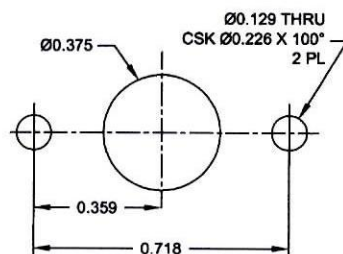

DRILLING DETAIL DD
SCALE 10X

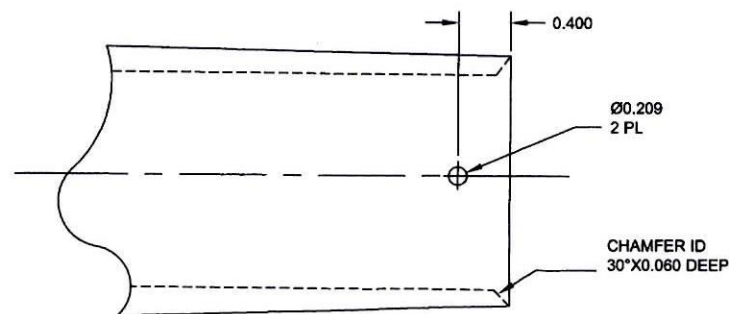

DETAIL EE
SCALE 2X

NOTES:
1) USE INDUSTRY STANDARD NUT PLATE DRILL JIG IF REQUIRED.

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	YR	D3391	SHEET 11 OF 11
APPROVED	AN	TITLE	SCALE
DE APPR.	CH	AFT TUBE ASSEMBLY	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMBANGED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER **PO039704**

Supplier: ATE003-VC
Atelier Debosselage
358 Principale
Calumet
QC
J0V 1B0 Canada
Phone: 819 242 5633

PO No: PO039704
PO Date: 4/25/18
Due Date:
Purchase Order
Revision:
Revision Date:
Ship-To Contact: Lavoie, Chantal
clavoie@dartaero.com

Ship To: 1270 Aberdeen Street
Hawkesbury
ON
K6A 1K7 Canada
Phone: 613-632-5200

Via: Ground
Pynt Terms: Net 30
Freight Terms:
Special Comments:

Items

Line Item	Job	Part	Description	Status	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
1	175480	D3391-023	Mid Tube Assembly	Firmed		1 pcs	0 pcs	1 pcs	\$125.00/pcs	\$125.00
	175479			Firmed		1 pcs	180 pcs	1 pcs	\$125.00/pcs	\$125.00
	175481			Firmed	4/25/18	1 pcs	180 pcs	1 pcs	\$125.00/pcs	\$125.00
Sub Total:						3	0	3		\$375.00
2	174835	D350-636-011	Skidtube LH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float Comp.	Firmed		1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
	175229			Firmed		1 pcs	180 pcs	1 pcs	\$225.00/pcs	\$225.00
Sub Total:						2	0	2		\$450.00
3	174817	D119-646-243	AW119 Repl. Skidtube with Heavy Duty Wearplates, Float Compatible - Fits LH or RH	Firmed		1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
	175231			Firmed		1 pcs	180 pcs	1 pcs	\$225.00/pcs	\$225.00
Sub Total:						2	0	2		\$450.00
Grand Total:									\$1,275.00	

Order Notes

Terms & Condition of Purchasing(Suppliers) and Procurement Quality Clauses are an integral part of our AS9100 requirements. To learn in detail, please visit www.dartaerospace.com for further explanation.

Plex 4/25/18 10:41 AM dart.lavoie.chantal



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER
PO039813

Supplier: ATE003-VC
Atelier Debosselage
358 Principale
Calumet
QC
J0V 1B0 Canada
Phone: 819 242 5633

Ship To: 1270 Aberdeen Street
Hawkesbury
ON
K6A 1K7 Canada
Phone: 613-632-5200

PO No:	PO039813
PO Date:	5/7/18
Due Date:	
Purchase Order	
Revision:	
Revision Date:	
Ship-To Contact:	Lavoie, ChantalPhone: clavoie@dartaero.com
Via:	Ground
Pynt Terms:	Net 30
Freight Terms:	
Special Comments:	REF: PO039794

Items

Line Item	Part	Supplier Part No	Item No	Description	Status	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
1		Paint	OUTSIDE SERVICES	D3391-023 PAINT RE-WORK	Firmed	5/7/18	1 Ea	0 Ea	1 Ea	\$0.00000001/Ea	\$0.00
										Grand Total:	\$0.00

Order Notes

Terms & Condition of Purchasing(Suppliers) and Procurement Quality Clauses are an integral part of our AS9100 requirements. To learn in detail, please visit www.dartaerospace.com for further explanation.

Plex 5/7/18 10:30 AM dart.lavoie.chantal



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER **PO039794**

Supplier: ATE003-VC
Atelier Debosselage
358 Principale
Calumet
QC
J0V 1B0 Canada
Phone: 819 242 5633

PO No: PO039794
PO Date: 5/4/18
Due Date: 5/7/18
Purchase Order Revision:
Revision Date:
Ship-To Contact: Lavoie, Chantal
Phone: clavoie@dartaero.com

Ship To: 1270 Aberdeen Street
Hawkesbury
ON
K6A 1K7 Canada
Phone: 613-632-5200

Via: Ground
Pymt Terms: Net 30
Freight Terms:
Special Comments:

Items

Line Item	Job	Part	Description	Status	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
1	175051	D350-636-011	Skidtube LH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float Comp.	Firmed	5/7/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
	175052			Firmed	5/7/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
Sub Total:						2	0	2		\$450.00
2	175054	D350-636-012	Skidtube RH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float Comp.	Firmed	5/7/18	1 pcs	0 pcs	1 pcs	\$250.00/pcs	\$250.00
	175060			Firmed	5/7/18	1 pcs	0 pcs	1 pcs	\$250.00/pcs	\$250.00
Sub Total:						2	0	2		\$500.00
3	175817	D135-751-011	Skidtube with Standard Wearplates Fits LH or RH	Firmed	5/7/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
	175818			Firmed	5/7/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
Sub Total:						2	0	2		\$450.00
4	175481	D3391-023	Mid Tube Assembly	Firmed	5/7/18	1 pcs	0 pcs	1 pcs	\$0.00/pcs	\$0.00

Line Item Note: RE-WORK

see PO039813

Grand Total: \$1,400.00

Order Notes

Terms & Condition of Purchasing(Suppliers) and Procurement Quality Clauses are an integral part of our AS9100 requirements. To learn in detail, please visit www.dartaerospace.com for further explanation.

Plex 5/4/18 10:02 AM dart.lavoie.chantal